

Identification: C02
Doc Type : TB - Technical Bulletin
Doc Nr : TB – PDD2012-14
Date: 25/06/2012
Issuer: Fabio Ornella (TDS)
Factory: PDD-Cooking Ovens - Pordenone



Subject [NEW MOTOREDUCTER FOR CAVITY VENTING VALVE](#)

Model ALL COMBI & CONVECTION LENGHTWISE OVENS GAS AND ELECTRIC

AOS....
 FCZ....
 EJM....
 HOR....
 RDR....

Problem Delivery from old Supplier not reliable

Solution Two new suppliers have been defined from the Factory.

Action in Factory The factory is now installing following motoreducers :

- Spare Part 0C8692 = **METEOR** branded, on NON USA appliances
- Spare Part 0C8695 = **CDC** branded, on USA appliances

Action in Field Old motoreducers are not available anymore. Here below the involved Spare Part Codes

	Old Spare Part	Supplier	New Spare Part	Supplier
USA appliances	0C1479	Fiber	0C8695	CDC
NON USA appliances	0C0883	Fiber	0C8692	Meteor

New motoreducer for USA appliances (**0C8695**) is fully interchangeable against previous one. No extra action is required. (see picture)




For NON USA appliances the situation is a little more complicated due to the fact that the Factory used an intermediate type of temporary Meteor motoreducer.

The replacement instructions differs from:


- Replacement against original Fiber motoreducer
- Replacement against intermediate temporary Meteor motoreducer

Replacement of 0C8692 against original old Fiber motoreducer :

- 1) Remove Fiber and fix Meteor from the back side with the 2 screws provided in the kit

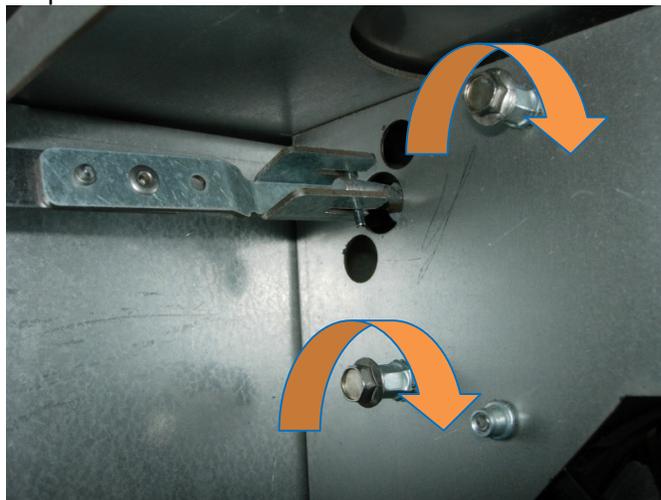

- 2) Connect the microswitch as follow :

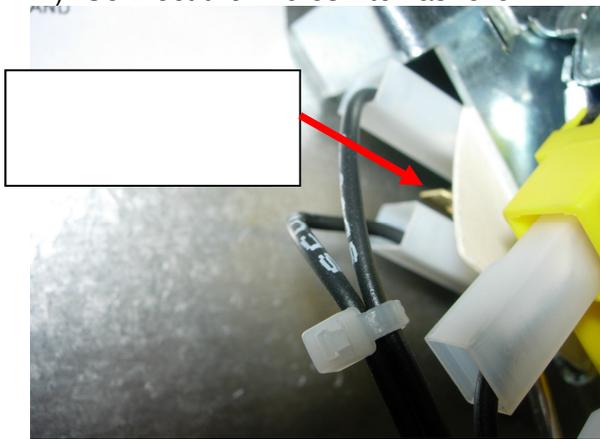

ELECTROLUX PROFESSIONAL SPA

MAILING ADDRESS

VIA SEGALUZZA, 30
33170 PORDENONE - ITALY

TELEPHONE

+39 0434 XXXXXX


TELEFAX

+39 0434 XXXXXX

E-MAIL ADDRESS

name.surname@electrolux.it

3) Connect the power using the connector

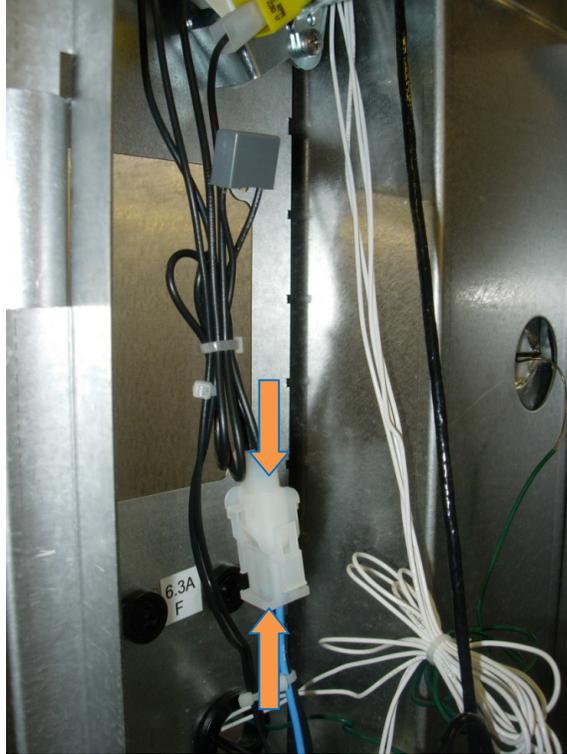

Replacement of 0C8692 against intermediate temporary Meteor motoreducer :

- The only difference against above instructions is related to the electrical connection onto the microswitch of the motoreducer
- The intermediate temporary Meteor motoreducer needed the opposite electrical connection (it needed the middle connection)
- The new 0C8692 needs the external connections on the microswitch. It does not need the middle one. Make sure you don't connect it (see below picture).

