

ISTRUZIONI PER LA SOSTITUZIONE DELL'ASSIEME BANDIERINE CON IL NUOVO ASSIEME ASTA CON BANDIERINE + SUPPORTO IN ABS

- 1) Spegnere il produttore di ghiaccio e scollegare il cavo di alimentazione;
- 2) rimuovere il top del produttore di ghiaccio;




- 3) rimuovere il coprievaporatore;



- 4) svitare le viti fissaggio pannello bandierine;



5) togliere l'assieme bandierine;

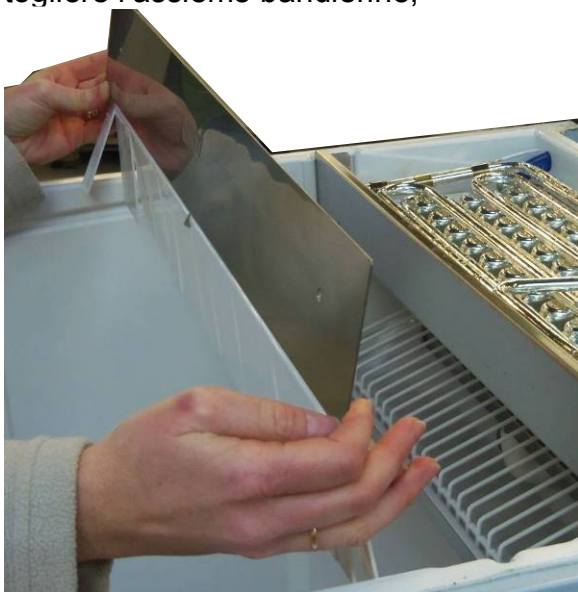


6) svitare le viti che fissano il supporto evaporatore alla cella;



7) sollevare il supporto evaporatore inox e l'evaporatore



sfilare e togliere il supporto evaporatore inox

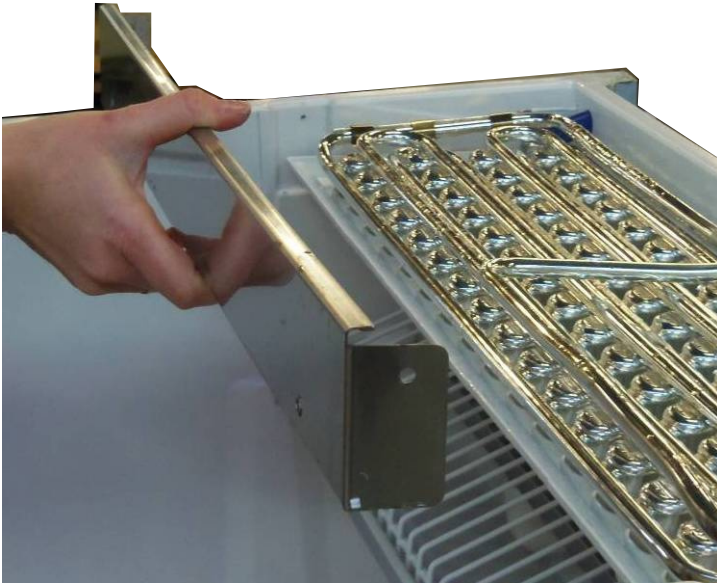

8) montare il nuovo supporto bandierine in abs



e fissarlo con 2 viti alla cella;



9) inserire l'assieme asta con bandierine nella sua sede



10) riposizionare il coprievaporatore nella sua sede



11) Rimontare il top.

INSTRUCTION TO REPLACE THE FLAG SUPPORT ASSY WITH NEW PLASTIC ONE

- 3) Turn ice maker off and disconnect power cable;
- 4) remove top panel of ice maker;



- 3) remove the evaporator cover panel;



- 4) remove the fixing screws;



5) remove flags support assembly;



6) unscrew the screws that fix evaporator support to basin;



7) rise SS evaporator support and evaporator



Remove SS evaporator support



8) install the new plastic evaporator support



secure with 2 screws;



9) install the new flags assembly



10) refit evaporator cover panel



11) refit top panel.